

Revoria Flow PC21 for Revoria Press PC1120  
 Revoria Flow EC11 for Revoria Press EC1100  
 Revoria Flow SC11/SC12 for Revoria Press SC180/SC170  
 GP Controller D01 for ApeosPro C810 Series  
 Revoria Flow E11 for Revoria Press E1136/E1125/E1100

## Security Update Guide

April, 30, 2024

### Vulnerability

Microsoft Corporation has announced vulnerabilities in Windows®. There are measures to fix these vulnerabilities which must also be implemented for our products - Revoria Flow PC21 for Revoria Press PC1120, Revoria Flow EC11 for Revoria Press EC1100, Revoria Flow SC11/SC12 for Revoria Press SC180/SC170, GP Controller D01 for ApeosPro C810 Series, Revoria Flow E11 for Revoria Press E1136/E1125/E1100.

Please follow the below procedure to fix the vulnerabilities.

The following procedure is intended that a System Administrator of the GX Print Server can fix the vulnerabilities. The steps described below must be performed on the GX Print Server.

### Update Programs

An Internet connection is required before proceeding. Access the following URL and download the updates.

Information Number of security essentials update		Information Number of security non-essentials update	
2024 Security Updates	2024/4	2024 Security Updates	-

- **Information Number of security essentials update: April,2024**

**Updates (Folder name)**

Ignore the updates if you have already implemented “KB5031539”.

2023-10 Servicing Stack Update for Windows 10 Version 21H2 for x64-based Systems (KB5031539)

- URL

<https://www.catalog.update.microsoft.com/Search.aspx?q=4ab54529-a352-44ca-8b4f-5d13b4cf69b5>

- File Name

ssu-19041.3562-x64\_de23c91f483b2e609cec3e4a995639d13205f867.msu

**Updates (Folder name)**

2024-04 Cumulative Update for Windows 10 Version 21H2 for x64-based Systems (KB5036892)

- URL

<https://www.catalog.update.microsoft.com/Search.aspx?q=701963a4-9265-47fa-b4e1-994ef948b5dc>

- File Name

windows10.0-kb5036892-x64\_3346840c83d2b0e13df6608bb1a118fdc08af709.msu

**Updates (Folder name)**

2024-04 Cumulative Update for .NET Framework 3.5 and 4.8 for Windows 10 Version 21H2 for x64 (KB5036608)

- URL

<https://www.catalog.update.microsoft.com/Search.aspx?q=2ff3b168-c761-4e86-9f6d-bc60fc4f43ec>

- File Name

windows10.0-kb5036608-x64-ndp48\_198eabe96517e4fce368274337c4a500b72337cb.msu

**Updates (Folder name)**

Update for Microsoft Defender Antivirus antimalware platform - KB4052623 (Version 4.18.24030.9) - Current Channel (Broad)

- URL

<https://www.catalog.update.microsoft.com/Search.aspx?q=Update%20Microsoft%20Defender%20Antivirus%20antimalware%20platform%20current%20channel>

- File Name

updateplatform.amd64fre\_8557bec7c3a1481381d9e8c204ba7f42db7f0cd9.exe

[Security intelligence updates for Microsoft Defender Antivirus and other Microsoft antimalware](#)

- URL

<https://www.microsoft.com/en-us/wdsi/defenderupdates>


- File Name

mpam-fe.exe


## ■ Download Procedure

(1) Access above URLs with Microsoft Edge.

(2) Click **Download**.

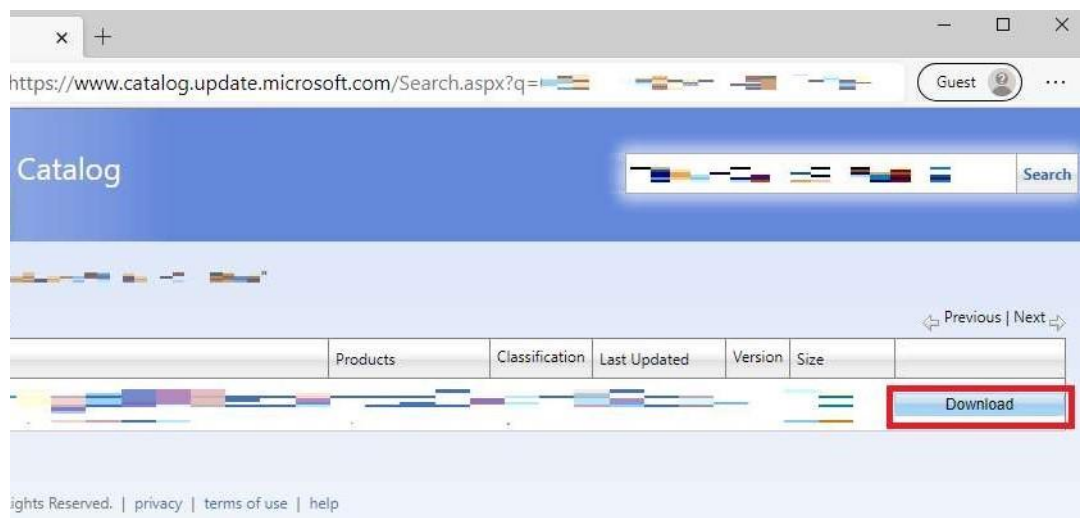

(3) Right-click on the file name, select **Save link as** from the menu.

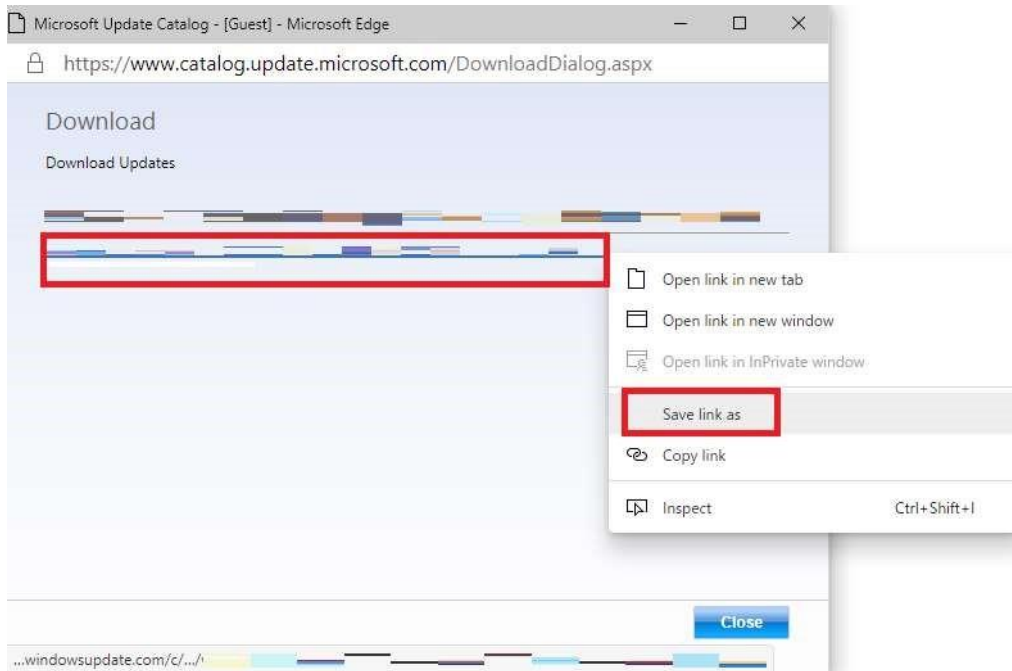

If there are more than one updates, perform the above step.

- (4) In the Save As screen, select the download destination for the updates, then click **Save**.
- (5) Updates will be saved to the location specified in Step (4).

## ■ Install Procedure

### 1. Preparation before Applying the Security Updates

#### 2. Copy the update files to any folder on the GX Print Server.

1. Turn the power to the Print Server off and disconnect the network cable.




- Metal parts are exposed on the back of the Print Server's main body.
- When disconnecting the network cable be careful to avoid being injured by these parts.
- Alternatively, you can disconnect the network cable on the hub side.

3. Turn the Print Server back on.

4. If the Print Service application is running, then terminate it. (Windows Start menu > Fuji Xerox > StopSystem or Windows Start menu > FUJIFILM Business Innovation > StopSystem) Terminate any other running applications.

5. Double-click on "D:\opt\PrtSrv\utility\ADMINtool\StartWindowsUpdate.bat".

6. Press return key to continue.

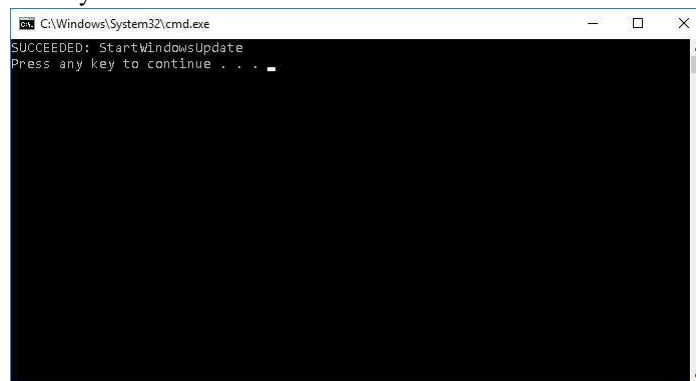

### 3. How to Apply the Security Updates.

1. Double-click on the security update file.




Before applying the security update close all the running applications (e.g., Print Service).


2. In the **Windows Update Standalone Installer**, click **Yes**.



3. The Installation will now begin.

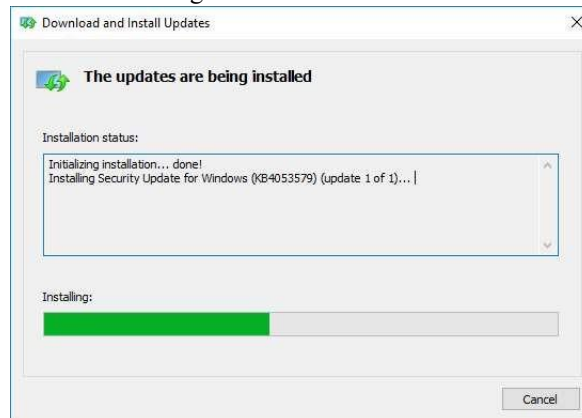

4. When the installation is finished, click **Close** to complete the setup.

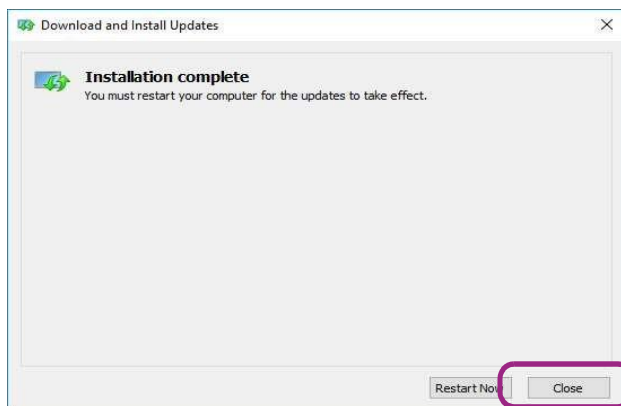


1. You can reboot the computer every time a security update is applied.

4. Confirming the Security Updates.

By following the procedure described below you can confirm if the update programs have been successfully applied.

1. Select **Start Menu > Settings > Control Panel > Programs and Features**.
2. In the left pane click **View installed updates**.
3. Confirm that the security updates that you applied are displayed in the list.

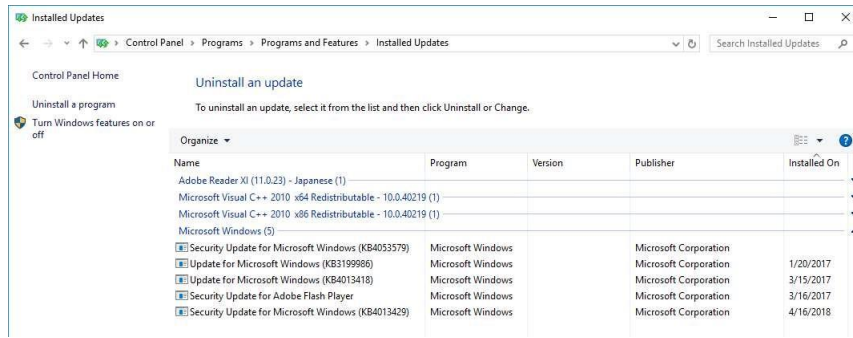

## 5. Completion

1. Shut down the Print Server and reconnect the network cable.
2. Turn the Print Server back on.